

Assembly & Installation Instructions

For Otto 5 Light Pendant 134407

A420

Page 1 of 4

CAUTION: FAILURE TO INSTALL THIS FIXTURE PROPERLY MAY RESULT IN SERIOUS PERSONAL INJURY OR DEATH AND PROPERTY DAMAGE. We recommend installation by a licensed electrician.


This product must be installed in accordance with applicable installation code(s), by a person familiar with the construction and operation of the product and the hazards involved.*

Caution: Do not exceed maximum wattage noted on fixture. Use only recommended bulbs with fixture.

To Install Fixture (Figure 1)

Component Parts

- A Fixture
- B Mounting Bracket
- C Caps (3)
- D Anchor
- E #10 Screws
- F Ground Screw
- L Fixture Support cable (2)
- M Fixture Support cable nut (2)
- N Cupped Washer

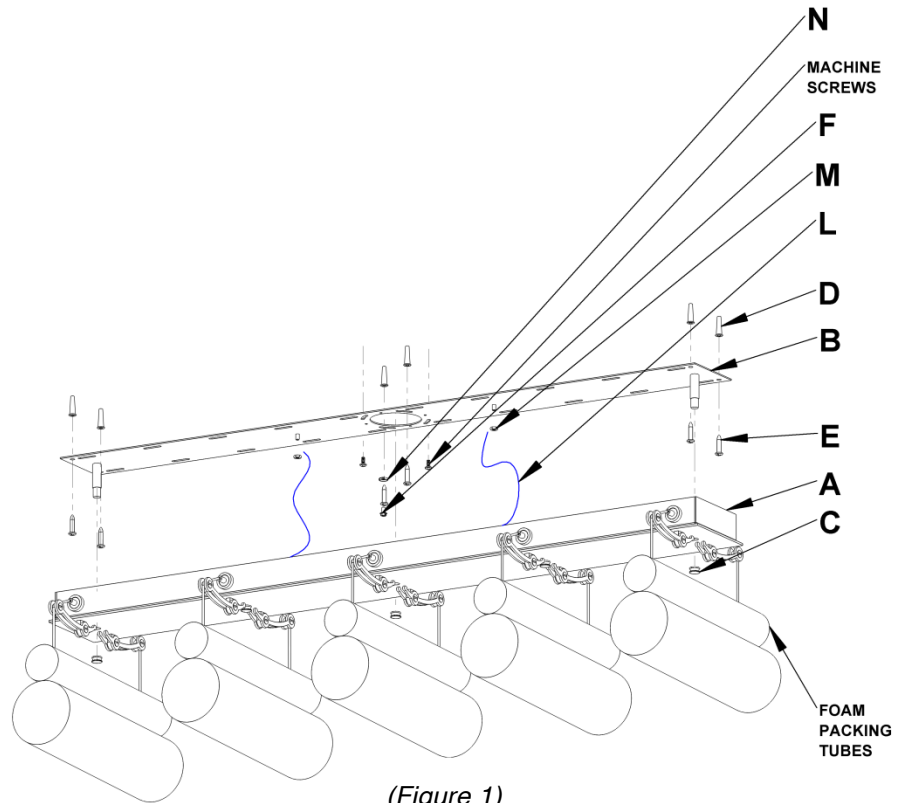

Caution: Be sure power is off at the main breaker box prior to installation. This installation requires 2 people.

1. Carefully unpack the fixture from the carton. **Do not remove foam packing tubes at this point.**
2. Mounting bracket (B) is shipped installed. Unscrew caps (C) and separate mounting bracket from fixture (A) and retain for later use.

Note: Only 3 of the 5 caps(C) are functional. Remove center cap with nipple and caps on each end to separate mounting bracket from fixture.

(Continued)

Assembly & Installation Instructions

For Otto 5 Light Pendant 134407

A420

Page 2 of 4

3. Place the mounting bracket (B) over the electrical box. With a pencil, mark the location of all mounting holes in the bracket (B) on the ceiling.

IMPORTANT: Mounting brackets must be secured to a solidly mounted to a framing member. Secure bracket at each end and also on either side of the junction box. Do not depend on drywall anchors alone to support this fixture. If in doubt, contact a qualified electrician.

4. Drill 1/4" holes in the locations marked on the ceiling. For holes using anchors, place the tapered end of the anchors (D) into the holes and gently tap them flush to the ceiling using a light weight hammer.
5. Thread the wires in the electrical box through the hole in the mounting bracket (B) while moving the bracket into position.
6. Using the 1" #10 screws (D), screw the bracket (B) securely to the ceiling. Be careful not to over-tighten or strip the anchors (D).
7. Using two machine screws (not provided) fasten bracket (B) to the electric box.

Note: A new electric box comes with screws. When replacing a fixture, retain the existing screws for use with the new fixture.

8. Temporarily support the fixture (A) by using fixture support cables (L). To utilize cables, unscrew fixture support cable nuts (M). Slide end of support cable (L) over stud and re-attach nuts (M).
9. Using suitable wire connectors (not provided) connect fixture wires to supply wires (white to white and black to black). Connect pigtail lead from the ground screw (F) and cupped washer (N) to the electrical box and connect all ground wires (bare copper or green to bare copper or green).

Caution: Make sure wire connectors are twisted on securely, and no bare wires are exposed.

10. Raise fixture (E) to the ceiling, sliding over nipples on mounting bracket (B) and secure with caps (C). Be sure cap (C) is fully seated on nipple.

(Continued)

Assembly & Installation Instructions

For Otto 5 Light Pendant 134407

A420

Page 3 of 4

To Install Glass (Figure 2 & 3)

Component Parts

G	Crosstube
H	Glass
I	Supply/Support Cables
J	Canopy gripper
K	Bulb


1. Remove foam tubes.
2. Install bulbs (K) (not included).
3. Raise crosstube (G) up. Screw glass (H) into socket cup until it stops and then unscrew one turn. Repeat with second socket cup. If glass (H) is bottomed out in fixture the glass may become crooked. It may be necessary to grip the cable (I) close to the socket cup to prevent cable (I) from twisting while screwing in glass.

Note: If glass (H) is bottomed out in fixture the glass may become crooked.

4. Push supply/support cables (I) into canopy gripper (J) until desired height is reached.

Note: Fixture is shipped at max height.

5. Restore electricity at main breaker.

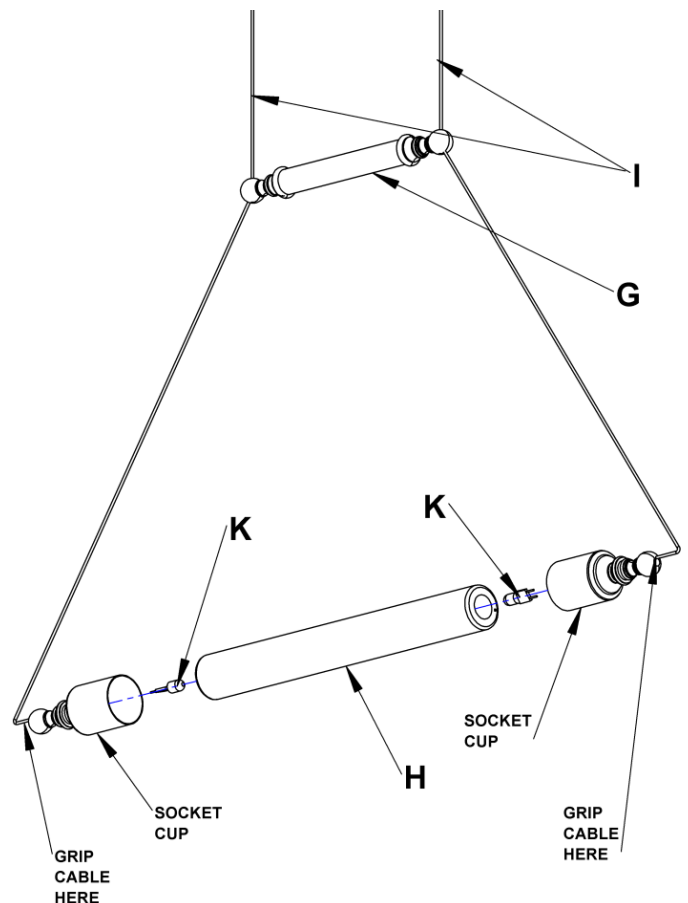

(Figure 2)


(Continued)

Assembly & Installation Instructions

For Otto 5 Light Pendant 134407

A420

Page 4 of 4

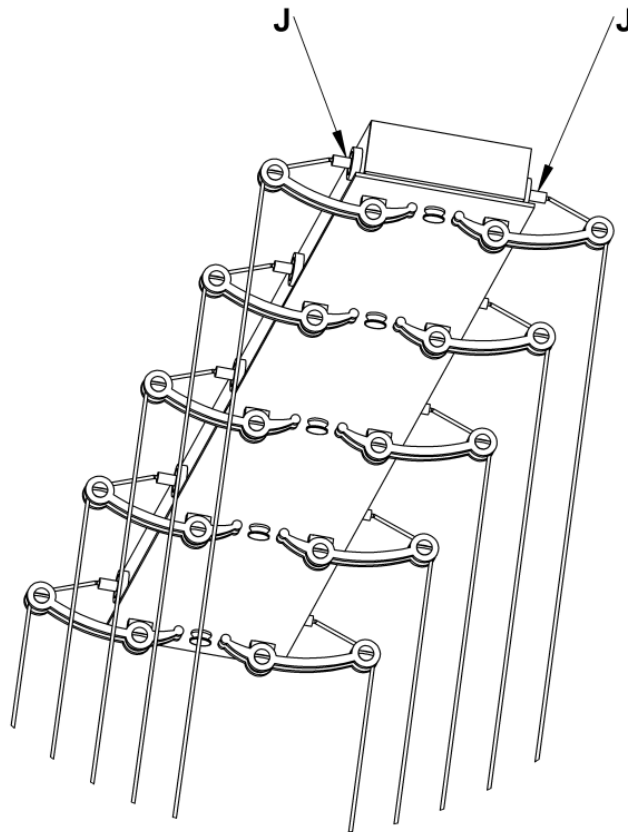

(Figure 3)

If you need further assistance, or find that you are missing any parts, please contact the dealer from which you purchased this product. We hope you enjoy your fixture!

* Hubbardton Forge will not be liable for injury or damage caused by improper installation, lamping or use of this fixture.